



Product Support Bulletin 2005-014

245 W. Forest Hill Avenue
Oak Creek, WI 53154

Contact: Gary D. Van Deluyster, Service Manager – Phone: 800-445-9258 – Fax: 414-766-2379

Maintenance of Way ~ Work Equipment Bulletin

DATE: December 9, 2005

SUBJECT: Emergency Hammer Lift Kit - 660120

RATING: **DIRECTIVE**
(Action is required)

ALERT
(Potential Problem)

INFORMATION
(Action is optional)

PRODUCT IMPROVEMENT
(Enhance Product)

MACHINE MODEL(S): Small Spiker Model SS-B


SERIAL NUMBER(S): 390200-390208

SUMMARY: The affected machines do not have a provision to raise the spike driving guns in the event of an engine or pump failure. Installing this kit will allow the spike driving guns to be raised with the emergency pump.

OPERATIONAL IMPACT: The machine will be able to be cleared for towing in the event of an engine or hydraulic pump failure without the use of jacks or other equipment.

ACTION: The kit consists of a Quick Disconnect and 3 fittings that are installed in the pressure port of the left hand Gun Control Valve Bank. A plug is removed from the valve and the fittings installed in the valve bank. A Dust Cap for the quick disconnect is also included. See Figure 1.

WARRANTY: Kits will be supplied for SS-B Spike Drivers s/n 390200-390208 at no charge. Please contact the Nordco Service Department to order the kits. Please have the serial number of the machine when calling. Machines starting with s/n 390209 will have this feature installed at the factory.

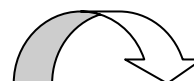

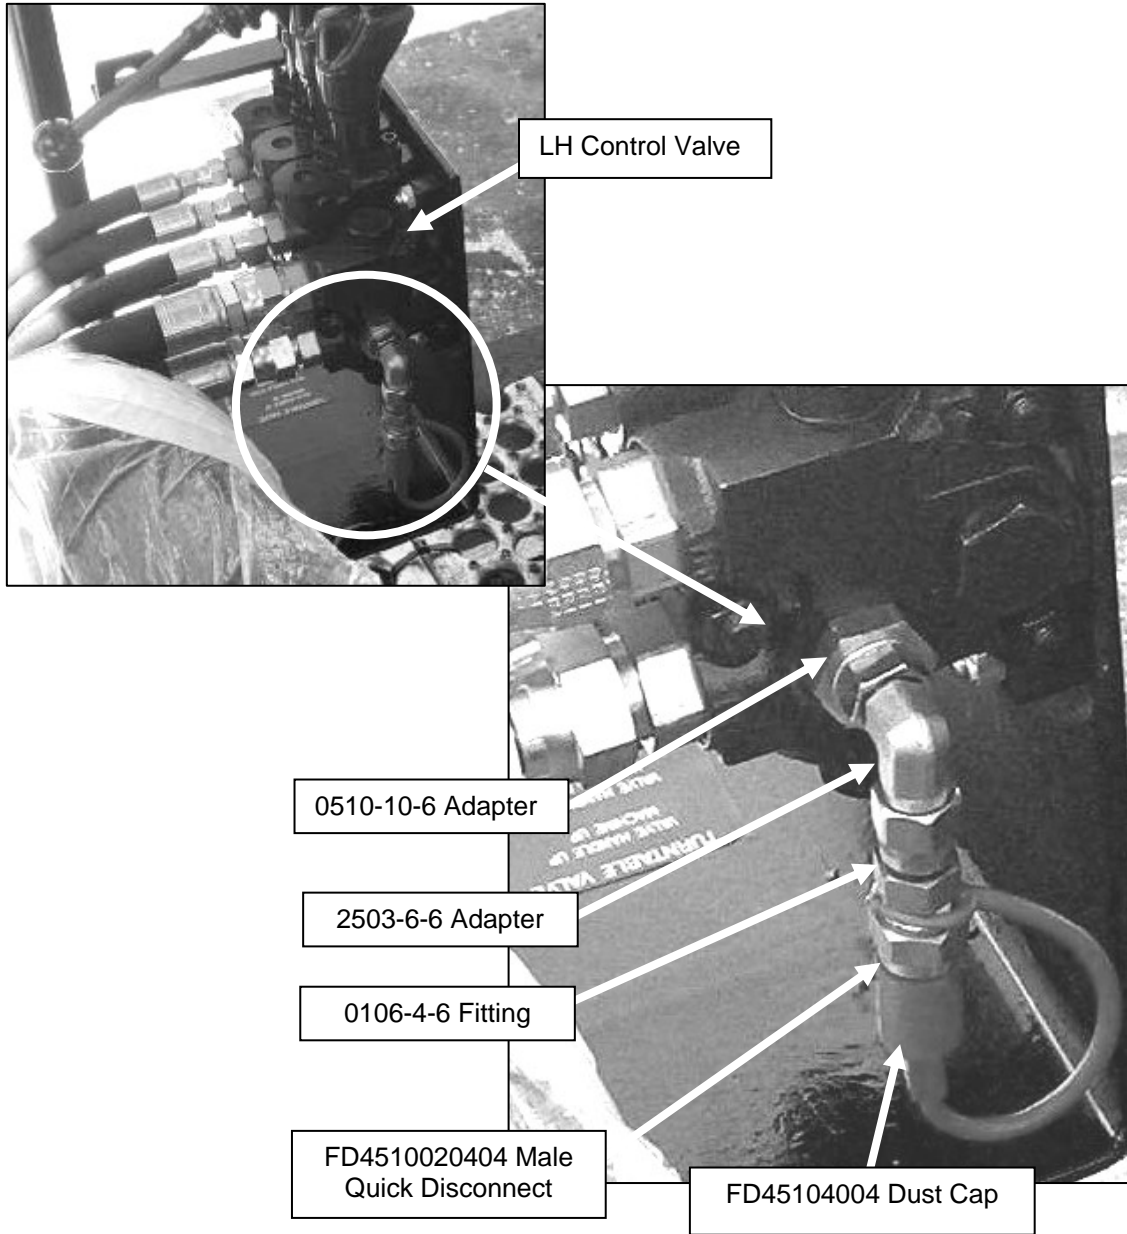


Figure 1